


BORAL CONSTRUCTION MATERIAL

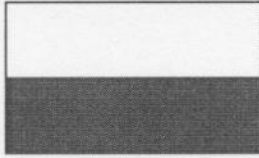

Materials Testing & Environmental Services

Boral Resources (NSW) Pty. Ltd.
A.C.N 000 756 507
Greystanes Rd PO Box 42
Wentworthville NSW 2145 Australia
Telephone 02 9688 9901 Facsimile 02 9688 9813

Registration No: 547

CLIENT: Bemac Laboratories - Mahaffey Assoc. P/L

FILE NO: 54/97

PROJECT: Quality Control

PLANT: Unknown

DATE RECD: 2.9.2005

DATE TESTED: 4.9.2005

AGE OF SPECIMEN: 28 days

TEST PROCEDURE: Determining Abrasion Resistance (Aust./NZ Standard 4456.9-97)

SAMPLE DESCRIPTION: Pavers 5966

LAB. SAMPLE NO: 4305

SPECIMENT NO:	PAVER BULK DENSITY kg/m ³	ABRASION INDEX
1	2.02	1.68
2	2.07	2.81
3	2.02	3.12
4	2.06	2.57
5	2.01	2.68
6	2.01	3.04
7	2.05	3.22
8	2.07	2.71
9	2.06	2.72
10	2.04	1.97
11	2.04	2.84
12	2.04	3.19
13	2.04	1.81
14	2.05	3.02
15	2.03	2.65
16	2.05	3.23
Mean Abrasion Index for the Sample		2.70
Unbiased Standard Deviation for the Sample		0.4898

Sample submitted by client.

B.Cockle, File, Ref: 1403. Rep

Authorised Signatory

Richard Bawer

Date 5.9.05 Serial No. 014614